

# Wenzhou Super Co M&E CO., LTD

## 产品规格书

### PRODUCT SPECIFICATION

客户名称Buyer Name	
客户料号Buyer Part No.	
客户承认签章 Buyers Approval & Signatures	

文件编号Spec No.		版本	A/1
品名描述 Product Description	线性振动马达 LINEAR VIBRATION MOTOR		
型号Part No.	C091022LR160		
送样日期Date			
设计Designed by	审核Checked by	批准Approved by	
王生	蓝羽	林天癸	
2020.12.01	2020.12.01	2020.12.01	

**- 目录/Contents -**

封面/Cover	1/10
目录/Contents	2/10
更改记录/Revision History	3/10
1. 适用范围/Operating scope	4/10
2. 储存, 使用条件/Storage, operating conditions	4/10
3. 测量条件/Measuring conditions	4/10
4. 外观要求/Appearance requirements	5/10
5. 技术参数/Specifications	5/10
6. 可靠性试验/Reliability test	7/10
7. 使用注意事项/Caution for use	8/10
8. 外形图/Outline drawing	9/10
9. 包装要求/Packaging requirement	10/10



1. Operating scope 适用范围


This specifications apply to linear vibrator model 0910.

本规格书适用于0910 线性振动器。

2. Storage, operating, conditions 储存, 使用条件

No	Items (项目)	Conditions (条件)
2-1	Operating temperature range 使用温度范围	-20 Celsius ~ +60Celsius -20°C~+60°C
2-2	Storage temperature range 储存温度范围	-30 Celsius ~ +70 Celsius -30°C~+70°C
2-3	Operating humidity range 使用湿度范围	Humidity:10~90%RH 湿度: 10~90%RH。
2-4	Storage humidity range 储存湿度范围	Humidity: 5~95%RH 湿度: 5~95%RH


3. Measuring conditions 测量条件

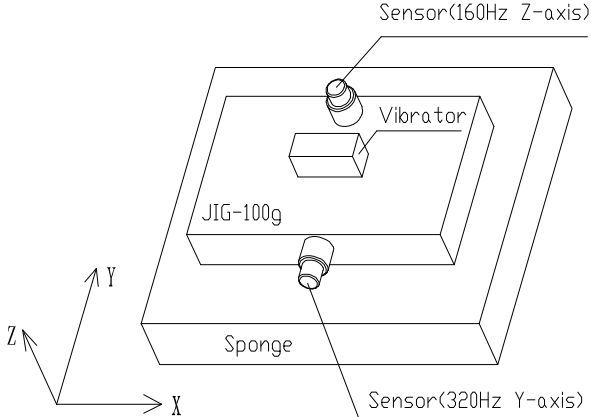
No	Items (项目)	Conditions (条件)
3-1	Ambient temperature 环境温度	20±5°C
3-2	Ambient humidity 环境湿度	65 RH±20%
3-3	Rated voltage 额定电压	DC3.0V square wave, Duty cycle 50%, 160Hz or 320Hz
		AC1.5Vrms sine wave, 160Hz or 320Hz
3-4	Input voltage Range 输入电压范围	DC 0~3.3V square wave, Duty cycle 50%
		AC 0~1.65Vrms sine wave
3-5	Measurement reference 测量参考	<p>Refer to the figure below to fix the vibrator and acceleration sensor, and then input the rated voltage for measurement 参照下图所示固定振动器和加速度传感器, 然后输入额定电压进行测量</p> 

4. Appearance requirements 外观要求


NO	Items(项目)	Requirements (要求)	Remarks (备注)
4-1	Shape structure size 外形结构尺寸	According to the outline drawing 依照外形图	Refer to outline drawing 参见外形图
4-2	Appearance 外观	No distortion、rust、stain, etc. 无变形、锈蚀、污迹等	Visual examination 目视检查

5. Specifications 技术参数

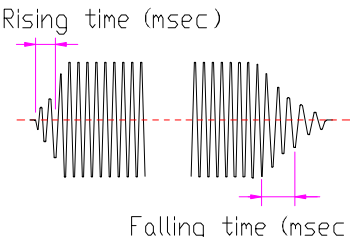NO	Items(项目)	Specifications(参数)	Remarks (备注)
5-1	Operating voltage 使用电压范围	DC 1~3.3V	Square wave
		AC 0.5~1.65Vrms	Sine wave
5-2	Rated Current 额定电流	180mA (Max)	At rated voltage 在额定电压下
5-3	Vibration direction 振动方向	160Hz Z axis direction 160Hz Z 轴方向  320Hz Y axis direction 320Hz Y 轴方向	
5-4	Acceleration 加速度	160Hz 3±1.2G	Refer to 3-5, (Recommended accelerometer VM83) 参照 3-5(推荐加速度计 VM83)
		320Hz 2.8±1.5G	
5-5	Rise time 启动时间	<50ms	The time reaching to 50% of normal acceleration from power on 通电达到正常加速度的 50%的时间
5-6	Break time 断开时间	<120ms	
5-7	Insulation resistance 绝缘电阻	5MΩ (Min)	100V DC, Between the vibrator terminal and case. 测试电压 DC100V, 端子和机壳间。
5-8	Weight 重量	7.5±1g	Use scale/用天平测量

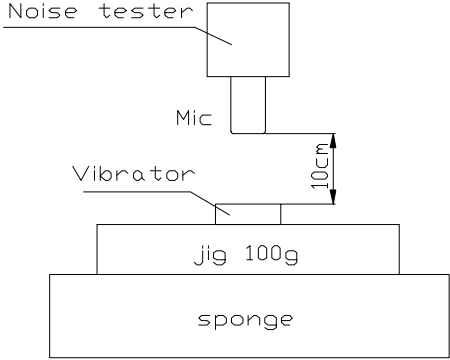5-9	Terminal resistance 端子电阻	8 Ω ±20%	AT 20°C
5-10	Mechanical noise 机械噪音	55dB-A (Max)	<p>At rated voltage and rated load; background noise 30dB-A(Max) 在额定电压和额定负载下, 背景噪音不超过 30dB-A.</p> 

6. Reliability test 可靠性试验

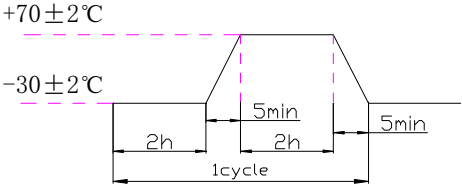
NO	Items(项目)	Standard test conditions(标准试验条件)	Judgment (判定)
6-1	Life test 寿命试验	Temperature 温度: $20 \pm 5^{\circ}\text{C}$ Humidity 湿度: $65\text{RH} \pm 20\%$ Test voltage 试验电压: Rated voltage 额定电压 Test model 试验形式: 1S on 1S off ( one cycle) Test cycle 试验周期: 160Hz 302400 cycles (168h) 320Hz 302400 cycles(168h)	
6-2	Low temp Storage 低温存放试验	Temperature 温度: $-40 \pm 2^{\circ}\text{C}$ Test time 试验时间: 120 hours	After the test, After 2 hours placed in ordinary temperature and humidity, vibrator shall be satisfy with specified in item 6-8 试验结束后, 在常温常湿下放置 2 小时后, 振动器应满足 6-8 项中的规定
6-3	High temp storage 高温存放试验	Temperature 温度: $80 \pm 2^{\circ}\text{C}$ Test time 试验时间: 120 hours	
6-4	Humidity storage 湿度存放试验	Temperature 温度: $50 \pm 2^{\circ}\text{C}$ Humidity 湿度: $90 \sim 95\% \text{RH}$ Test time 试验时间: 120 hours	
6-5	Temperature shock 温度冲击	<div style="text-align: center;">  </div> <p>Test duration 试验持续时间: 6cycles</p>	
6-6	Packing vibration test 包装振动试验	Total peak amplitude 全振幅: 1.5mm (P-P) Frequency 频率: 60Hz Period 周期: 10-55-10Hz Direction 方向: X, Y, Z Test time 试验时间: 30 minutes at each stage 每个阶段 30 分钟	
6-7	Parking Drop test 包装跌落试验	outside box is dropped from 1 corner , 3 edge and 6 surface each 1 time from the height of 0.6m, to the concrete floor 外箱从 1 角、3 棱、6 面各 1次从 0.6 米高度落至混凝土地面	
6-8	1、Acceleration 加速度: Initial Value $\pm 50\%$		
	2、Rated Current 额定电流: Max. 180mArms		
	3、Noise T 噪音: Max. 55dB		
	4、There should be no abnormalities in appearance and structure. 外观和结构应无异常。		

## 7. Caution for Use 使用注意事项


- 1) Please use vibrator in the specification of this specification. Otherwise the service life and performance of the vibrator will be affected.  
请在本规格书规范内使用振动器，否则会影响振动器的使用寿命和性能。
- 2) Vibrators can't be used in high temperature, High humidity and corrosive gas environment.  
振动器不能在高温、高湿度和有腐蚀性气体环境中使用。
- 3) The vibrator shall be firmly fixed in the direction of vibration, Otherwise it will be prone to noise.  
振动器应牢牢固定在振动方向上，否则容易产生噪声。
- 4) The vibrator has a strong magnet, So please be aware that it has a magnetic force on the surface of the bracket.  
振动器有一个强的磁铁，因此请注意，它的机壳表面有磁力。
- 5) Do not press the product with more than 15N , It can cause the transformation of performance or external appearance.  
不要用超过 15N 的力按压振动器，那样会导致性能或外观的变化。
- 6) Please use the vibrator within 6 months, If it exceeds the storage period, you need to re-check and confirm it.  
请在 6 个月内使用振动器，如果超过存储周期，则需要重新检查和确认。
- 7) Under the conditions of meeting this specification, our company can change the material、size and shape of parts to improve quality、 performance or production efficiency.  
在满足本规范的情况下，我司可以改变零件材料、尺寸及形状来改善品质、性能或生产效率。
- 8) If there is any argument on vibrator performance and/or life, judgment is to be made base on this specification only.  
如对振动器的性能和（或）寿命有任何争议，仅基于此规格书作出判断。




8. Outline drawing 外形图

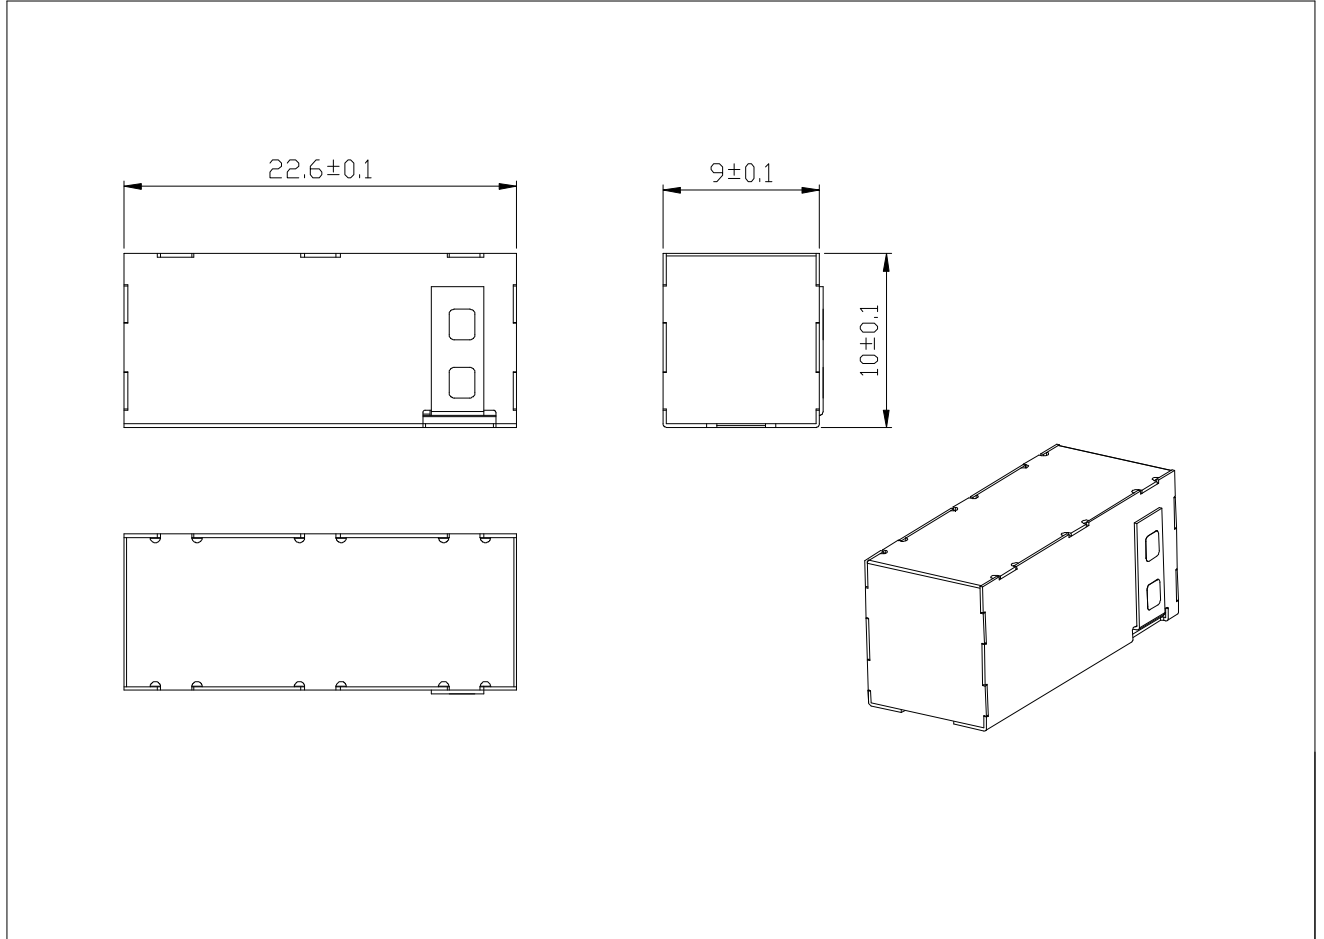


9. Packaging requirements 包装要求

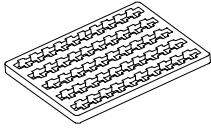


Each tray is equipped  
with 50 vibrators  
每托盘装50只振动器

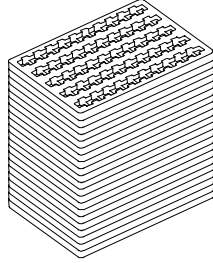


1000 vibrators per heap  
每堆1000只振动器

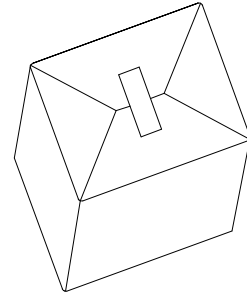

Use plastic bags to  
prevent humid  
用塑料袋包装防潮

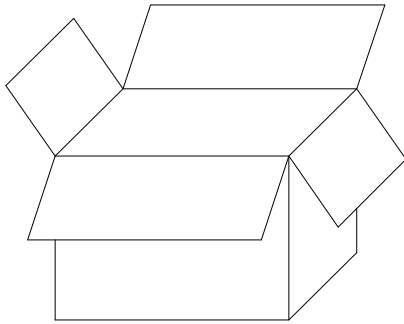

Each packing box is equipped  
with 2000 vibrators  
每个包装外箱装2000只振动器

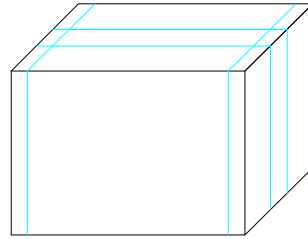

Seal the outer box with adhesive  
tape and tie it firmly with  
packing strap  
用胶带密封外箱，并用打包带捆扎牢固。